


Known Issue: KH T-bar Mounting Bracket

Problem:

The barrel of the slotted insert is hitting the other L-bracket, preventing proper tightening of the plate on the slotted tube.

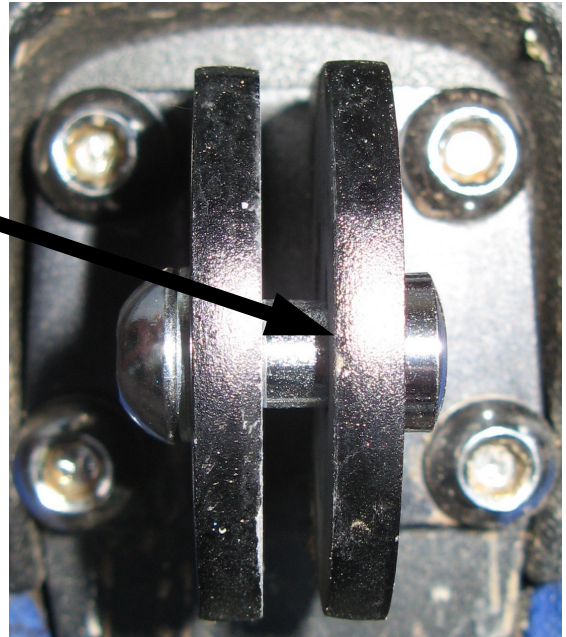

Solution: the hole for the hex bolt needs to be re-drilled to 8 mm diameter (or 5/16").

This is the same diameter as the hole on the other L-bracket.

This allows sufficient room for the barrel on the threaded insert to tighten properly.

